



# TraceTek TT3000 and TT5000 Series

## Modular Sensing Cables

### Installation Instructions

---

#### General Information

These instructions explain the proper procedures for installing and testing TT3000 and TT5000 series modular and zone sensing cables, and provide specifics for sumps, subflooring, and containment trenches.

For double-containment pipe applications, refer first to the *TraceTek Double-Containment Installation Guide* (LIT-138); for double-wall tank applications, refer first to the *General Instructions for TraceTek Installation in Double-Wall Tanks* (H55313).

The *General Installation Instructions for TraceTek Environmental Applications* (H55523) provides an overview of the installation process for the TraceTek system, and refers to detailed instructions for each step.

To obtain copies of installation instructions, consult Tyco Thermal Controls at +1 650-216-1526.

#### Tools and Materials for Installation and Testing

- TT-PTB-1000 Portable Test Box with adapters **or** ohmmeter (20-M $\Omega$  range or greater)
- TT-ULTRATORCH flameless heating tool **or** appropriate heat gun.
- TT-MLC-MC Modular Leader Cable (needed for testing with ohmmeter)
- TT-MET-MC Modular End Terminations (not needed for zone cables)

#### **Additional materials for sump, containment trench, or subfloor applications:**

- For TT3000 sensing cable: TT-HDC-1/4 or TT-HDC-1/4-200-NA Hold-Down Clips
- For TT5000 series sensing cables: TT-HDC-1/2-NA-50 hold-down clips
- 3M-type 1300 or 08001 adhesive (obtained locally) for hold-down clips with no adhesive (not required for TT-HDC-1/4)

#### Complete Bill of Materials

Before beginning installation, confirm there is a plan for the leak detection system layout, and a complete bill of materials. In addition to sensing cables, the leak detection bill of materials

should include a TraceTek alarm module, leader and/or jumper cables, mapping (TT-TAG), and various other components, such as Modular Branching Connectors, (TT-MBC-MC).

#### General Notes—Do's and Don'ts


##### **Do**

- Store the sensing cable in its original container in a clean, dry area prior to installation.
- Schedule sensing cable installation after major construction work (which could damage or contaminate the cable) has been completed.
- Clean the area where sensing cable is to be installed and remove any debris or other source of contamination.
- Replace TT5000 series hydrocarbon sensing cable once it has contacted a solvent or fuel.


##### **Don't**

- Drag sensing cable through contaminants (such as pipe dope, PVC cement, solvents, oil, dirt).
- Use damaged or contaminated sensing cable.
- Solder or weld near the cable without protecting it from heat, flux, and splatter.
- Use pulling lubricants to install TraceTek sensing cables.
- Drop tools or sharp or heavy objects onto the cable.
- Pull the sensing cable with excessive force (more than 50 pounds/20 kg).
- Place TT5000 series sensing cable where it is subject to pinching or pressure, as this will trigger an alarm.
- Subject TT5000 series sensing cable to temperatures higher than 80°C (176°F).
- Use adhesive tapes or clamping devices to secure the sensing cable.
- Allow cable connectors to become wet, dirty, or contaminated.


## General Layout of TraceTek System

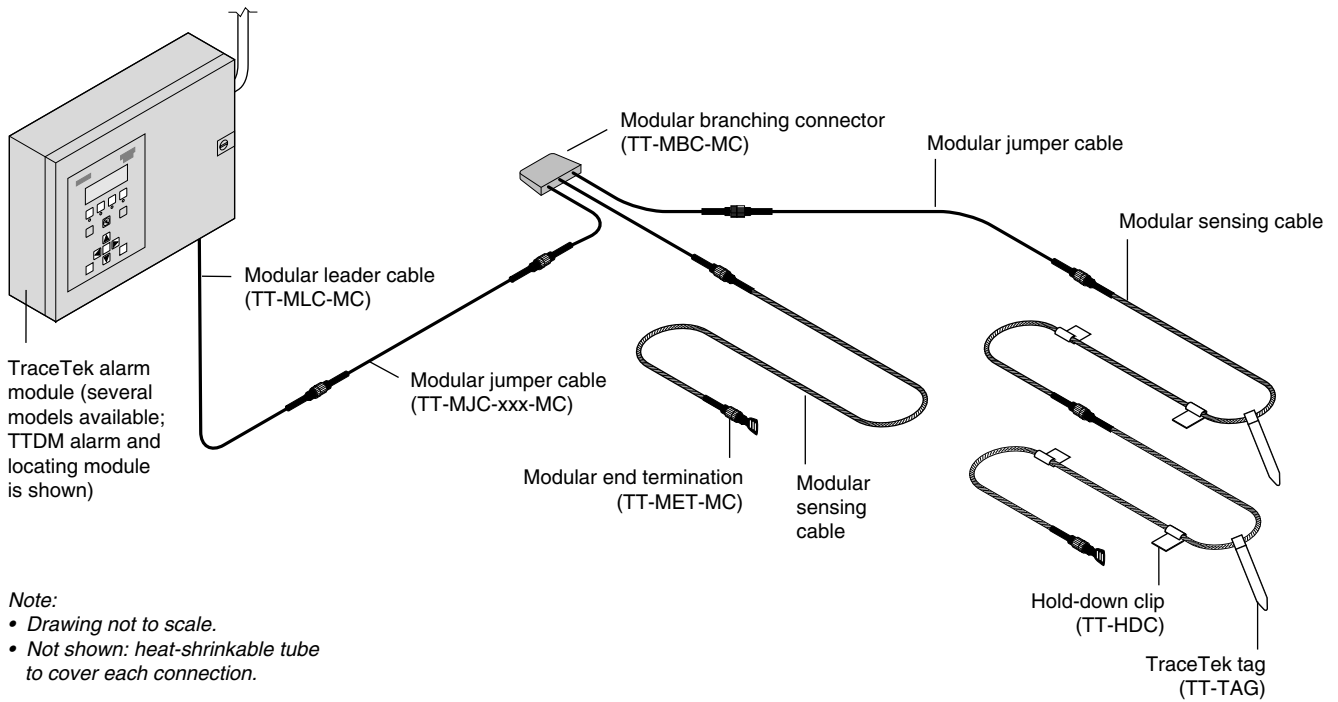

### Modular Sensing Cable (with factory-installed connectors)

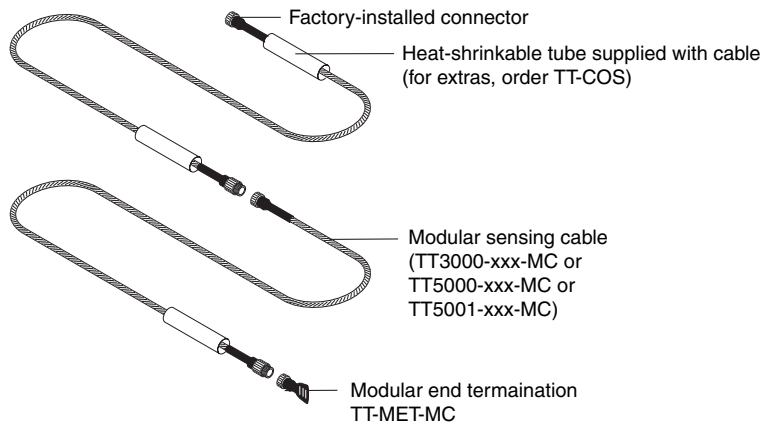

### Zone Sensing Cable (with factory-installed connector and end termination)

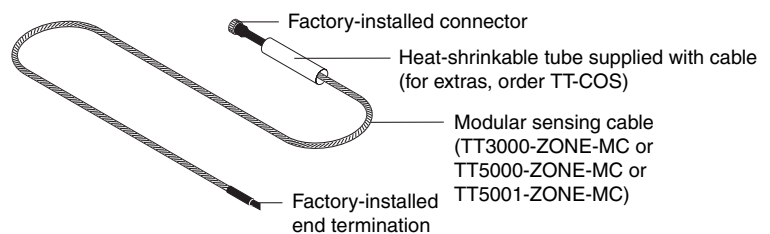

## Installation Steps

### 1. Prepare the area where the sensing cable will be located.

 

- Verify that major construction is complete.
- Clean the area where the cable will be installed to remove debris and sources of contamination. For techniques in double-containment piping, consult the *TraceTek Double-Containment Installation Guide* (LIT-138).
- For sumps, containment trenches, and subfloor applications, install TraceTek hold-down clips. For TraceTek TT3000 sensing cables, use 1/4" hold-down clips (TT-HDC-1/4...); for TraceTek TT5000 series sensing cables, use 1/2" hold-down clips (TT-HDC-1/2-NA-50).

Clean the floor surface where hold-down clips will be placed so adhesive can work properly.

Position hold-down clips so the sensing cable will provide the desired leak detection coverage. To best secure the cable, alternate the direction of the hold-down clips, and install them at intervals of no greater than 6 feet (2 m) and at every change in direction (at sides of trench, for example).


**Important:** Let the adhesive dry per manufacturer's recommendation before proceeding with sensing-cable installation.

- In sumps that may collect water, mount TT5000 series sensing cable vertically to allow it to detect hydrocarbons floating on water; prepare for this by installing hold-down clips up side of sump.

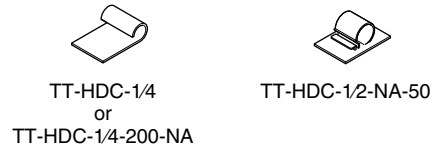


### 2. Check each length of sensing cable before installation.

To ensure that each length of sensing cable is intact and free of contamination, follow the Sensing Cable Test Procedure detailed on page 6. Do not use damaged or contaminated sensing cable.

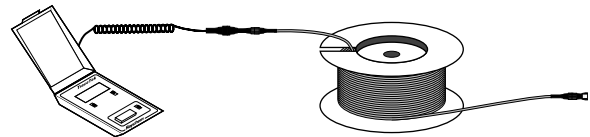

### 3. Observe proper precautions when handling sensing cables.

 Observe the do's and don'ts under "General Notes" on page 1 of these instructions; take care to avoid damaging or contaminating sensing cable.




## Installation Steps (continued)

### 4. Connect, orient, install, and test each length of sensing cable in sequence.

1. **Connect** a Modular End Termination (TT-MET-MC) to the first sensing-cable length to be installed.


**Note:** This step is not required for a zone sensing cable, which has a factory-installed end termination.

If installing modular sensing cable in double-contained piping, refer to the *TraceTek Double-Containment Installation Guide* (LIT-138) for detailed instructions.

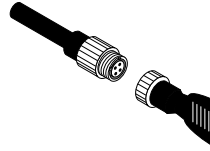

2. **Orient** sensing cable so end termination will be away from connection to the TraceTek alarm module. Work out from the alarm module connection. For sensing cable on reels (lengths over 10 feet), put the reel on an axle and pull the cable out.

Connector with pins toward module

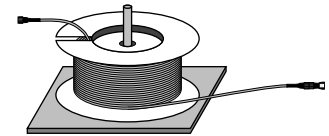

3. **Install** sensing cable in accordance with the leak detection layout plan.


For sumps, containment trenches, and subfloor applications, pull the cable alongside the installed hold-down clips; minimum bend radius is 2" (50 mm). Leave 6" (150 mm) of sensing cable on each end for the connector service loop.

**Important:** Verify that the adhesive securing the hold-down clips has dried; liquid adhesive must not contact the cable.


Push sensing cable into the hold-down clips and position the sensing cable to lay flat on the surface to be monitored.

In sumps that may collect water, mount at least a portion of TT5000 series cable vertically.

Be sure not to leave TT5000 series cable so it may be kinked, pinched, or subjected to pressure, as this may trigger an alarm.

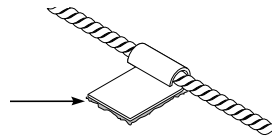

 4. **Test** each length of sensing cable after installing it and before attaching it to cable already installed. Confirm that the sensing cable is clean and intact by following the Sensing Cable Test Procedure detailed on page 6.



5. **Connect** the sensing cable to the cable string (lengths of sensing cable connected in series) previously installed; before making connection push heat-shrinkable tube onto sensing cable.


 
**Note:** If installing sensing cable in a double-wall tank or other inaccessible location, the heat-shrinkable tube must be shrunk down **before** installation; see step 5 on page 5 for instructions.

For sumps, containment trenches, and subfloor applications:

- Leave a service loop at each connector as shown.
- Mark the connector position on the layout plan.
- Install TraceTek mapping tag (TT-TAG).

**Note:** As an extra precaution on large installations, periodically test the entire cable string to confirm that all installed sensing cable is still clean and intact.

Unplug the end termination and connect it to the next length of sensing cable to be installed.

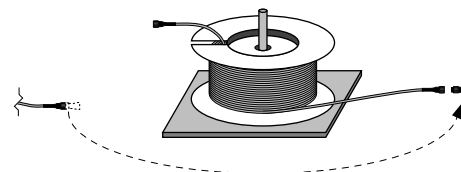


**Repeat the installation sequence for each length of cable.**


## Installation Steps (continued)

### 5. Complete the system.

 
- Install other TraceTek components (such as Modular Branching Connectors, Weighted Lengths, and Modular Jumper Cables) as called for in the system layout. Complete the sensing circuit.



 - Test the sensing circuit (or portions of it) to confirm that the sensing cable is clean and intact. Follow the Sensing Cable Test Procedure detailed on page 6.




- Install heat-shrinkable tubes over all mated male/female (pin/socket) connections
  - Move the heat-shrinkable tube along the sensing cable until it is centered over the mated connection.
  - Using a heat gun or Ultratorch, shrink the tube over the connection. Begin in the center and shrink toward each end until tube fully conforms to the shape of the connection.

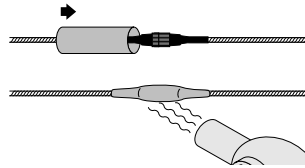

**Note:** If a heat-shrinkable tube must be removed (for example, for cable testing), refer to *Oversleeve Removal Instructions* (H54258).


- Connect the sensing circuit to the TraceTek alarm module and activate the system as soon as is practical. Use the module to monitor for events during the final stages of construction.

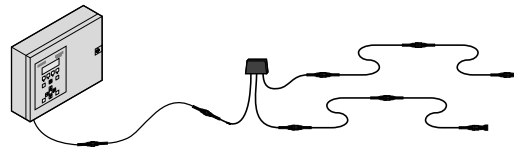

### 6. Take precautions if installation is incomplete at end of work day.


#### At the end of the work day:

 - Ensure that there are no exposed connectors. Each sensing cable should be connected to a Modular Leader Cable (TT-MLC-MC), Modular End Termination (TT-MET-MC), and/or other sensing cables; check both ends of the cable.
- Test and record the condition of installed sensing cable following the Sensing Cable Test Procedure on page 6.
- If practical, connect the installed sensing cable to the TraceTek alarm module. Test the system and put it in operation following the alarm module installation instructions.



#### At the beginning of the next work day:

 - Check that the installed sensing cable is clean and intact following the Sensing Cable Test Procedure. Compare the results with those obtained at the end of the previous work day. If necessary, investigate and correct problems before proceeding.



## Sensing Cable Test Procedure


### Method with TraceTek Portable Test Box (PTB)

1. Ensure the end termination is connected to the sensing cable. If checking several lengths of sensing cable in series (a cable string), ensure they are all connected.
2. Connect the PTB to the sensing cable(s) using its adapter, as illustrated.
3. **Verify that the sensing cable is intact;** follow the operating instructions printed inside the lid of the PTB itself. If the cable string is intact, the PTB measures the system length (length of TraceTek sensing cable plus the length equivalents of the weighted lengths and modular branching connectors). *If a cable or connection is broken,* the PTB illuminates its LED indicating "cable break," and displays a "1" in the leftmost position of its LCD display.


*If the cable string is not intact,* apply this test procedure to segments of the system to identify the open connection or damaged modular length.

**Note:** If a heat-shrink tube must be removed to access a connector, refer to *Oversleeve Removal Instructions* (H54258).

Testing a cable string

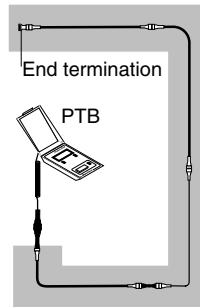

Testing an individual length of cable

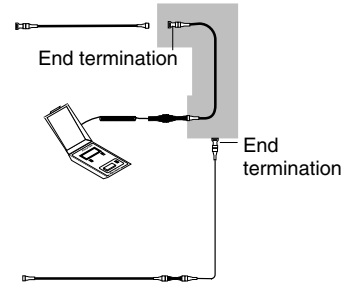


4. **Check the condition of the sensing cable(s),** again following the PTB operating instructions. If the sensing cables are clean and free of contamination, the current measured should be below 10  $\mu\text{A}$ . *If the reading exceeds 10  $\mu\text{A}$ ,* use the PTB to locate the liquid or contamination and take appropriate corrective action.

### Method with Ohmmeter

1. Ensure the end termination is connected to the sensing cable. If checking several lengths of sensing cable in series (a cable string), ensure they are all connected.
2. Connect a Modular Leader Cable (TT-MLC-MC) to the sensing cable.
3. **Verify that the sensing cable is intact:**

- Loop 1: Measure the resistance between the yellow and black wires of the leader cable as illustrated.
- Loop 2: Measure the resistance between the red and green wires of the leader cable.

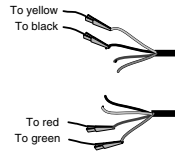

The readings should roughly equal a multiple of the length of sensing cable:

- 4 times the length of sensing cable (in ft) or
- 12 times the length of sensing cable (in m)


Example: 4 x 50 ft of cable = 200  $\Omega$ ,  
12 x 15 m of cable = 180  $\Omega$ .

In addition, the resistance of the two loops should be within 5 percent of each other.


*If the cable string is not intact,* apply this test procedure to segments of the system to identify the open connection or damaged modular length.

**Note:** If a heat-shrink tube must be removed to access a connector, refer to *Oversleeve Removal Instructions* (H54258).

Testing a cable string

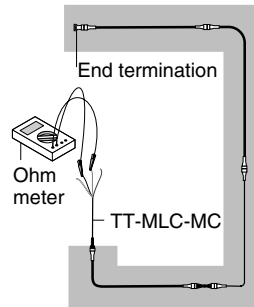

Testing an individual length of cable

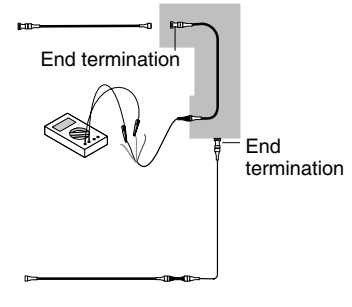

4. **Check the condition of the sensing cable.** Measure the resistance between the black and green wires of the leader cable.
  - *If the reading is below 20 M $\Omega$ ,* apply this test procedure to segments of the system to identify the modular sensing cable length(s) affected, locate the liquid or contamination, and take appropriate corrective action.

Tyco and TraceTek are trademarks or registered trademarks of Tyco Thermal Controls LLC or its affiliates.

**Important:** All information, including illustrations, is believed to be reliable. Users, however, should independently evaluate the suitability of each product for their particular application. Tyco Thermal Controls makes no warranties as to the accuracy or completeness of the information, and disclaims any liability regarding its use. Tyco Thermal Controls' only obligations are those in the Tyco Thermal Controls Standard Terms and Conditions of Sale for this product, and in no case will Tyco Thermal Controls or its distributors be liable for any incidental, indirect, or consequential damages arising from the sale, resale, use, or misuse of the product. Specifications are subject to change without notice. In addition, Tyco Thermal Controls reserves the right to make changes—without notification to Buyer—to processing or materials that do not affect compliance with any applicable specification.

---

**Worldwide Headquarters**  
**Tyco Thermal Controls**  
300 Constitution Drive  
Menlo Park, CA 94025-1164  
USA  
Tel (800) 545-6258  
Fax (800) 596-5004  
info@tycothermal.com  
[www.tycothermal.com](http://www.tycothermal.com)

**Europe**  
**Tyco Thermal Controls**  
Staatsbaan 4A  
3210 Lubbeek  
Belgium  
Tel (32) 16/213-511  
Fax (32) 16/213-600

**Asia**  
**Tyco Thermal Controls**  
9th floor, Yeul-Chon Building  
24-1, Yeoido-Dong  
Youngdeungpo-ku  
150-010 Seoul, South Korea  
Tel (82) 2-2129-7731  
Fax (82) 2-785-4700